


Please route to :

	Init.
<input type="checkbox"/> Service	<input type="checkbox"/>
<input type="checkbox"/> Sales	<input type="checkbox"/>
<input type="checkbox"/> Parts	<input type="checkbox"/>

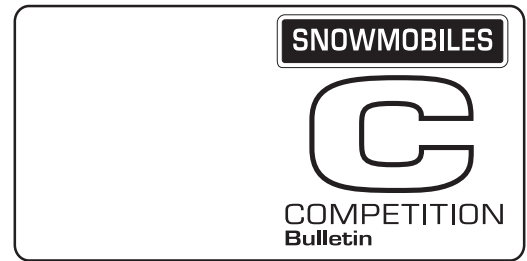

No. **97-1**

Date: December 2, 1996

SUBJECT: Radiator/Track Protection

YEAR	MODEL	MODEL NUMBER	SERIAL NUMBER
1997	FORMULA* III/III (LT) Can. FORMULA* III/III (LT) U.S.	1148/1151 1149/1152	ALL
1997	FORMULA* Z Can. FORMULA* Z U.S.	1145 1146	ALL
1997	MACH* 1/MACH* Z/MACH* Z (LT) Can. MACH* 1/MACH* Z/MACH* Z (LT) U.S.	1177/1180/1183 1178/1181/1184	ALL
1997	GRAND TOURING* 583 Can. GRAND TOURING* 583 U.S.	1126 1127	ALL
1997	GRAND TOURING* SE Can. GRAND TOURING* SE U.S.	1129 1130	ALL
1997	MX Z* 583/MX Z* 670 Can. MX Z* 583/MX Z* 670 U.S.	1174/1193 1175/1194	ALL

When using a high profile track in conjunction with a SC10 High performance suspension or a SC10 Cross Country suspension, damage may occur due to interference of the track with the radiator underneath tunnel when suspension is fully compressed.

To avoid this situation, a radiator protection kit (P/N 414 9313 00) must be installed and the gap between the track and the radiator must be increased by replacing the two 110 mm (4.33 in) upper idler wheels supporting the track with two 100 mm (3.9 in) idler wheels (P/N 572 0918 00).

PARTS REQUIRED

P/N	DESCRIPTION	QTY
414 9313 00	Radiator protection kit	1
572 0918 00	Idler wheel	2

The parts are available through our regular parts channel.